Fire Risk Assessment


Property assessed:

Client:

UPRN:

1-33 56 High Street Manchester M4 1ED Riverside 9404020930 Property Classification: Level 1

26/02/2019 Document Print Date:

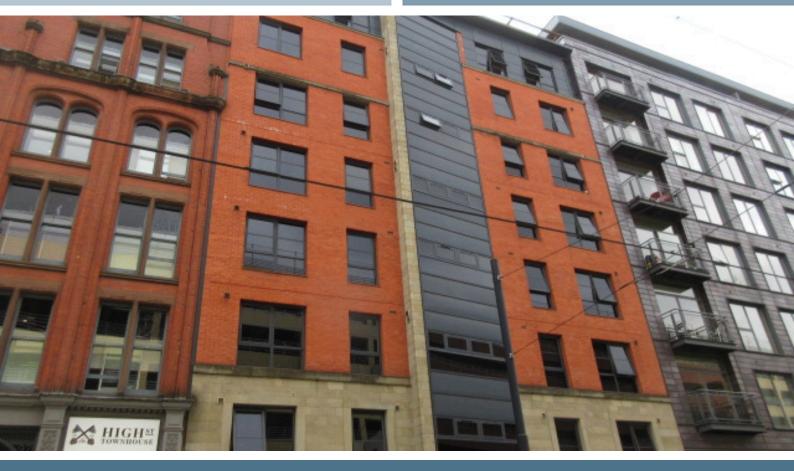

FRA Inspection Date: FRA Issued to Client: FRA valid to: FRA completed by:

13/06/2018 03/09/2018 03/09/2019 Savills (UK) Ltd, 33 Margaret Street, London W1G 0JD T: 020 7409 8737 E: fireriskhousing@savills.com



Contents



- **1** Executive Summary
 - 1.1 Compliance and Risk Record
 - **1.2** Recommendation Summary
 - **1.3** Evacuation Strategy
- 2 N/A
- 3 Introduction and Scope
 - 3.1 Limitations
 - 3.2 Legislation
 - 3.3 Risk Level
 - 3.4 Recommendation Priorities
- 4 Property Details
- 5 N/A
- 6 BAFE Certificate

Please Note - The Action Plan within this report will update to reflect the status of each recommendation as at the date on which the report is generated. Please refer to the Document Print Date on the cover page.

1 Executive Summary



| Property Classification | Level 1 |
|------------------------------------|-------------------------------|
| BAFE SP205 -1 Certificate Number | Refer to Master Property List |
| Responsible Person | Riverside |
| Assessment Completed by | Richard Maze |
| Assessment Checked by | Stephen Montgomery |
| Date of inspection | 13/06/2018 |
| Date of Assessment Issue to Client | 03/09/2018 |

| Taking into account the fire prevention measures observed at the time of this risk assessment, it is considered that the hazard from fire (likelihood of fire) at this property is: | Medium |
|---|---------------|
| Taking into account the nature of the property and occupants, as well as fire protection and procedural arrangements observed at the time of this fire risk assessment, it is considered that the consequences for life safety in the event of fire would be: | Moderate Harm |
| The derived assessment risk rating of the property is: | Moderate |
| On satisfactory completion of all remedial works the risk rating of this property may be reduced to: | Tolerable |

Recommended Reassessment Date

03/09/2019





1.2 Recommendation Summary

| Priority | Number of recommen | idations not complete |
|----------|-----------------------|-----------------------|
| | At time of assessment | At report print date |
| U | 0 | 0 |
| A | 4 | 4 |
| В | 8 | 8 |
| с | 2 | 2 |
| R | 0 | 0 |
| Man1 | 2 | 2 |
| Man2 | 23 | 23 |

Note: See section 3.4 for the timescales associated with each priority in the table above.

1.3 Evacuation Strategy

| Evacuation strategy for this property at time of assessment | Stay Put |
|---|--|
| Notes | The property is a purpose built block with an adequate standard of compartmentation. The current Stay Put evacuation strategy is considered appropriate. |
| Recommended evacuation strategy for this propeerty | Stay Put |

3 Introduction and Scope



3.1 Limitations of this assessment

This fire risk assessment report represents the Fire Risk Assessment Company's understanding for the current building designs and use, the fire strategy and proposed evacuation procedures. It is to provide an assessment of the risk to life from fire and does not address building or property protection or business continuity. The report is not an assurance against risk and is based on the best judgement of the consultant involved. The assessment may rely on information given by others and no liability is accepted for the accuracy of such information. Should any of the properties (or their operations) change in any way the risk assessments should be updated accordingly. In addition, it is recommended that this fire risk assessment is reviewed at least annually. Each fire risk assessment identifies areas to which access was not available during the inspection. In certain instances, we may have made recommendations for further inspection in the report, however as general guidance we would recommend that the 'no access' areas are inspected as soon as possible.

3.2 Legislation

This fire risk assessment has been carried out to meet the requirements of The Regulatory Reform (Fire Safety) Order 2005 [the Order]. The following is a summary description of some of the key articles listed in the Order:

| Article 3 | Defines the responsible person as a.) the employer, bi.) the person in control of the premises, or b.ii) the owner/landlord. |
|------------|---|
| Article 4 | Defines the meaning of general fire precautions |
| Article 5 | States 'a person in control of the premises' may be a person who has an obligation for the maintenance / repair of the premises or the safety in the premises. |
| Article 6 | Lists exemptions, which includes domestic premises occupied as a single private dwelling. |
| Article 8 | Requires general fire precautions are undertaken to ensure the safety of employees / relevant persons. |
| Article 9 | Requires the responsible person to carry out a fire risk assessment. This assessment must be reviewed regularly and if there is reason to suspect that it is no longer valid there has been a significant change. |
| Article 11 | Defines the responsible person as a.) the employer, bi.) the person in control of the premises, or b.ii) the owner/landlord. |
| Article 13 | Requires the recording of significant findings from the fire risk assessment, where a.) five or more people are employed, b.) a licence under an enactment is in force, or c.) an alterations notice is in force. |
| Article 14 | Requires that escape routes and exits are kept clear and accessible at all times. |
| Article 15 | Highlights the need for fire drills and competent persons to assist in their undertaking. |
| Article 17 | Requires suitable maintenance of fire safety facilities and equipment. |
| Article 19 | Requires communication with employees, including the significant findings of the fire risk assessment. |
| Article 20 | Requires that any external employers / employees who are working (or have staff working) in premises are provided with relevant information on the risks and the preventive and protective measures in place. |
| Article 21 | Requires that employees are provided with suitable and appropriate training. |
| Article 22 | Requires co-operation / coordination where two or more responsible persons share duties in premises. |
| Article 23 | Lists the general duties of employees at work. |



3.3 Risk Level

A suitable risk-based control plan should involve effort and urgency that is proportional to risk. The following riskbased control plan is based on one advocated by BS 8800 for general health and safety risks:

| Risk level | Action and time table |
|-------------|---|
| Trivial | No action is required and no detailed records need be kept. |
| Tolerable | No major additional controls required. However, there might be a need for improvements that involve minor or limited cost |
| Moderate | It is essential that efforts are made to reduce the risk. Risk reduction measures should be implemented within a defined time period. Where moderate risk is associated with consequences that constitute extreme harm, further assessment might be required to establish more precisely the likelihood of harm as a basis for determining the priority for improved control measures |
| Substantial | Considerable resources might have to be allocated to reduce the risk. If the building is unoccupied, it should not be occupied until the risk has been reduced. If the building is occupied, urgent action should be taken. |
| Intolerable | Building (or relevant area) should not be occupied until the risk is reduced. |

It should be noted that, although the purpose of estimating the risk level is to place the risk in context, the above approach to fire risk assessment is subjective and for guidance only. All hazards and deficiencies identified in this report should be addressed by implementing all recommendations contained in the following action plan. The fire risk assessment should be reviewed regularly and a reassessment completed by the date recommended in this report.

3.4 Recommendation Priorities

All recommendations made for remedial action as result of the fire risk assessment are assigned a priority in this report. The priorities used have an associated timescale for completion of the recommendations. These are as follows:

| Recommendation Priorities: | Recommended Timescales |
|----------------------------|------------------------|
| U | 1 day |
| A | 3 months |
| В | 12 months |
| С | 12 months |
| R | Unlimited |
| Man1 | 1 month |
| Man2 | 3 months |

The above timescales may be altered when the action plan for the premises is collated with other properties in the stock. Please refer to the collated action plan in the Client Portal.

Property Details



| UPRN | 9404020930 |
|----------------------|------------------------------------|
| Number Range | 1-33 |
| Building Name | |
| Street Number | 56 |
| Street | High Street |
| City/Town | Manchester |
| Postcode | M4 1ED |
| Property Designation | General Needs (6 Storeys and over) |

| Building Layout Information | |
|--|---|
| Total No. of Floors | 8 |
| Total No. of Floors (common area only) | 8 |
| Total No. of Storeys (ground and above) | 8 |
| Ground Floor Area (m2) (if applicable) | N/A |
| Total Area of All Floors (m2) (if applicable) | N/A |
| Building Layout Description | A purpose built eight storey mid terrace building containing a total of 33 flats on floors 1-7. The single stairway is lobbied at all floor levels. Commercial premises and the access to the flats accommodation are located at ground floor level. Hopper lids to a refuse chute are located at each floor level. The bins store, sluice room, tank room and the electricity meter apparatus room are locate at ground floor level. A fire fighting lift and a dry rising fire main are provided, with riser outlets located in the access lobbies at each floor level. Two final exits - one to the front and one to the rear. Level access. |
| Extent of Common Areas (area assessed) | Entrance hallway, stairway enclosure, access lobbies, service areas. |
| Areas of the building to which access was not available. | Individual flats with the exception of flat 29, water tank room (key not available) |
| Total number of Flats/Bedsits/Bedrooms (as applicable) | 33 |
| Number accessed off the Common Area | 33 |
| Flats/Bedsits/Bedrooms sample inspected | Flat 29 |
| Building Use | Mixed Use |
| Details of ancillary use (if applicable) | Commercial premises are located at ground floor level. |
| Total No. of Common Entrances/Exits | 2 |
| Block Accessibility | Level |
| Total No. of Common Staircases | 1 |

| Construction Information | |
|--------------------------|---------------|
| Construction Type | Steel Frame |
| Property Type | Purpose Built |



| Construction Information | | |
|---|---|--|
| Date of Construction or Conversion (year approx.) | 2010 | |
| Floor Construction Type | Concrete | |
| Stair Construction Type | Concrete | |
| External Wall Construction Type | Cavity Masonry | |
| External Wall Finish Type | Brick | |
| Other Construction Information | External walls are brick with predominant glass panels. | |

| Occupant Information | |
|---|--|
| Management Extent | Partially Managed Building (Manager or Senior Staff not onsite regularly) |
| Details of any onsite management | No onsite management |
| Person managing fire safety in the premises | Lisa Roberts Asset Compliance Manager - Performance & Compliance Team |
| Person consulted during the FRA | Occupants of flat 29 only |
| Number of Residents | Assumed to be two residents per flat |
| -Comments | Exact numbers not known |
| Number of Employees | No staff on site |
| -Comments | Occasional staff attendance assumed - low numbers expected |
| Number of members of the public (maximum estimated) | Residential - low number |
| -Comments | Residential block - low number of visitors expected at any one time |
| Identified people especially at risk | General Needs - No information |
| -Comments | No information, however, General Needs premises so occupants are assumed to be typical of the general population |

| Other information | |
|---------------------------------------|---|
| Fire loss experience (since last FRA) | No evidence of recent fire loses was noted at the time of the inspection. |
| Any other relevant information | These premises are understood to be owned and maintained by the Riverside Group and Riverside Home Ownership. |

In preparing this report reference has been made to a number of key legislative and guidance documents as identified below. Other guidance documents may also be applicable to the assessment which have not been listed here. A full list of guidance documents used in the assessment is available from the risk assessment company on request.

| Fire Safety Legislation | |
|---|--|
| Main fire safety legislation applying to these premises | 01) Regulatory Reform (Fire Safety) Order 2005 |
| Other applicable legislation | |



| Fire Safety Guidance | |
|---|---|
| Main fire safety guidance used in this assessment | 01) LGA - 'Fire safety in purpose-built blocks of flats' - 2012 |
| Other key fire safety guidance referred to | PAS79 - 'Fire Risk Assessment - a recommended methodology' - 2012 BS 5266-1:2016 - 'Emergency Lighting - Code of practice for the emergency lighting of premises' BS 5266-8:2004 - 'Emergency escape lighting systems' BS 5499-4:2013 - 'Safety signs. Code of practice for escape route signage' BS 5839-6:2013 - 'Fire detection and alarm systems for buildings. Code of practice for domestic premises' BS 5499-10:2014 - 'Guidance for the selection and use of safety signs and fire safety notices' |

BAFE Certificate

| Part 1a | Name & Address of Certificated Organisation: Savills (UK) Ltd, 33 Margaret Street, London, W1G 0JD |
|---------|---|
| Part 1b | BAFE registration number of issuing Certificated Organization: NSI00539 |
| Part 2 | Name of client: Riverside |
| Part 3a | Address of premises for which the fire risk assessment was carried out: 1-33 56 High Street Manchester M4 1ED |
| Part 3b | Part or parts of the premises to which the fire risk assessment applies: Common Parts only (not dwellings, where applicable) |
| Part 4 | Brief description of the scope and purpose of the fire risk assessment: Life Safety (as per agreed Specification) |
| Part 5 | Effective date of the fire risk assessment: 03/09/2018 |
| Part 6 | Recommended date for reassessment of the premises: 03/09/2019 |
| Part 7 | Unique reference number of this certificate: Refer to Master Property List |

This certificate is issued by the organization named in Part 1 of the schedule in respect of fire risk assessment provided for the person(s) or organization named in Part 2 of the schedule at the premises and / or part of the premises identified in Part 3 of the schedule.

We, being currently a 'Certificated Organization' in respect of fire risk assessment identified in the schedule, certify that the fire risk assessment referred to in the schedule complies with the Specification identified in the schedule and with all other requirements as currently laid down within the BAFE SP205 Scheme in respect of such fire risk assessment.

Signed for and on behalf of the issuing Certificated Organization:

John Herbison FCABE MIFireE (Director)





Date of Issue

03/09/2018

